

ARP-K-DG-LA

SMALL BLOCK MOPAR

INSTALLATION GUIDE



QUALITY AMERICAN MADE SUPERCHARGERS



Installation Instructions

SMALL BLOCK MOPAR SINGLE


ARP-K-DG-LA



STEP 1

Disconnect battery.

*Install supercharger plate
ARP-DG10031 using (1) 3.750"
spacer to the head with a
3/8 x 4.5" bolt. And (2) .312"
spacers between the bracket and
the water pump with
(2) 3/8 x 5.5" bolts.*

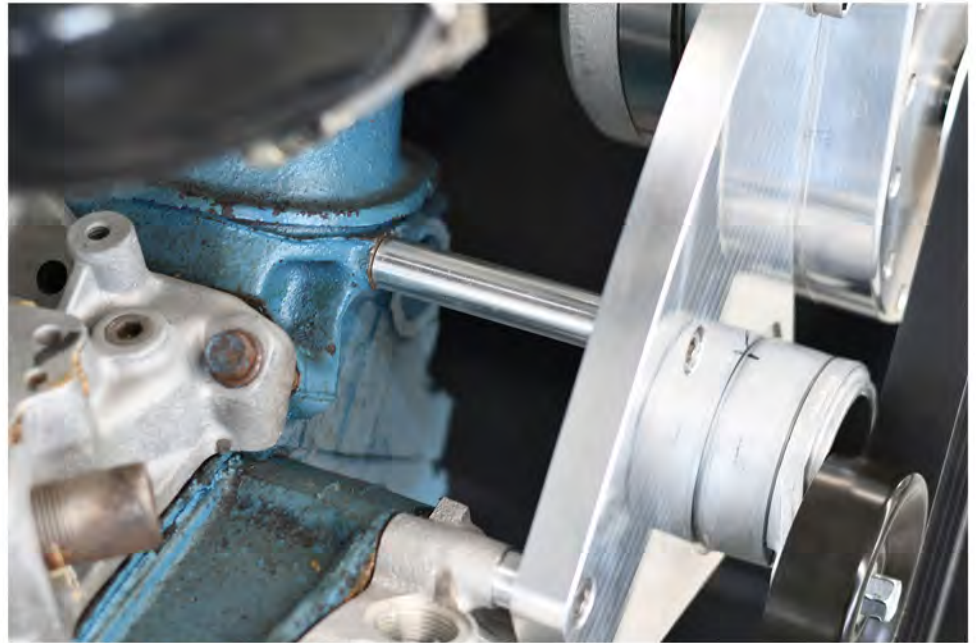

Installation Instructions

SMALL BLOCK MOPAR SINGLE

ARP-K-DG-LA



STEP 2

Install crank pulley and hub spacer using (6) 5/16-18 x 1" bolts and washers.

(refer to layout sheet)

Apply blue lock tight

Tighten to 17 ft lbs



STEP 3

Install the supercharger using (7) 3/8-1 3/4" shcs and an washers.

(Loosen the v-band clamp on the compressor housing and clock the outlet towards the carb.

Leave loose until you are satisfied with your plumbing.) When finished, tighten clamp only until the compressor housing can no longer rotate. Approx. 1/4" of thread showing on the clamp.

Torque to 29 ft lbs



Installation Instructions


SMALL BLOCK MOPAR SINGLE

ARP-K-DG-LA



STEP 4

Install supercharger belt. Use a 15mm long wrench on the bolt on the tensioner pulley pulling clockwise to release tension. Then slip the belt under the pulley.

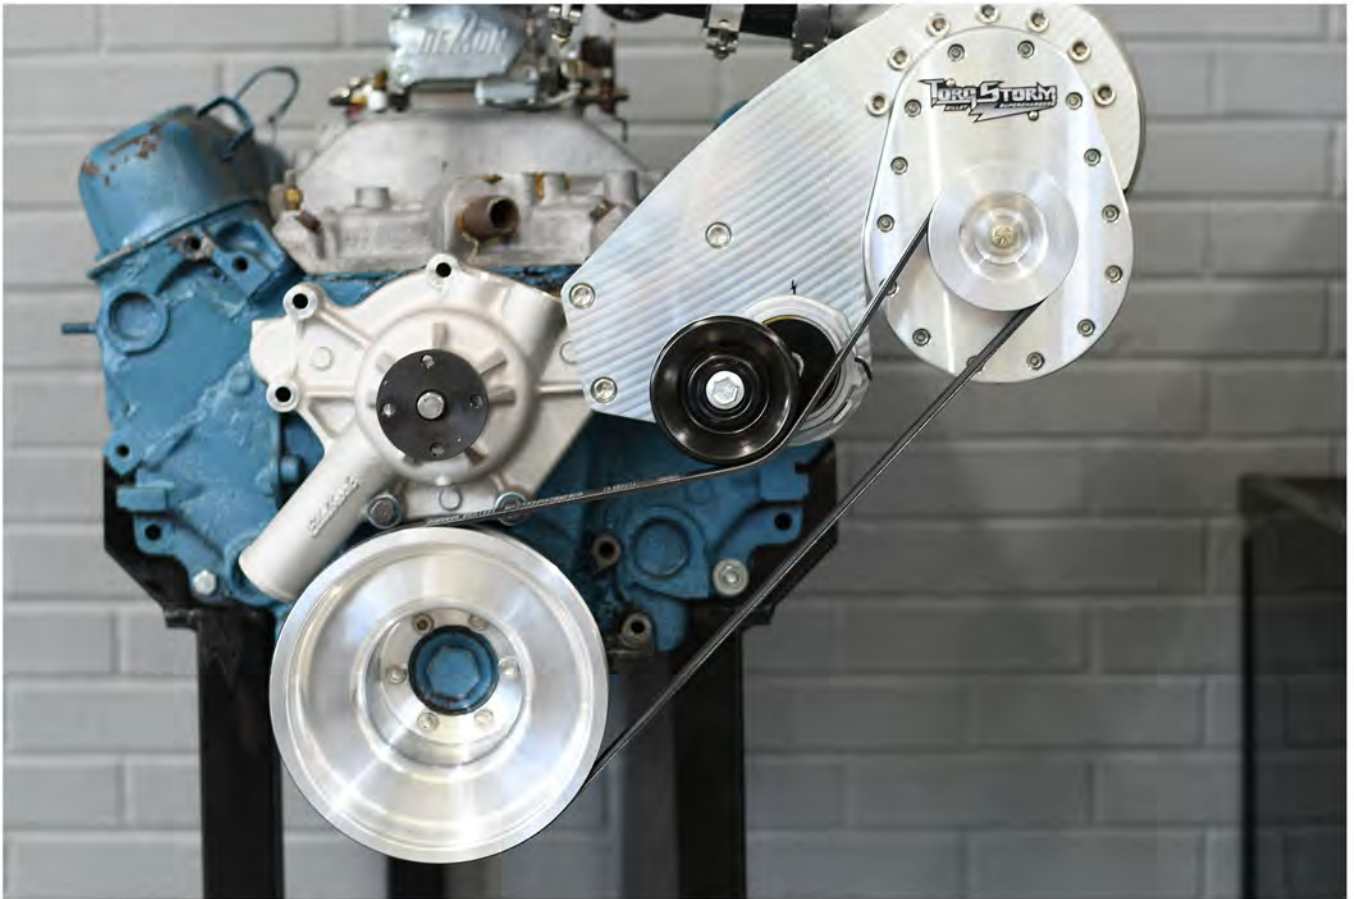

Installation Instructions

SMALL BLOCK MOPAR SINGLE

ARP-K-DG-LA



STEP 5

Install supercharger air filter.

Install Carb hat with supplied o-ring and nut. Snug down.

Install plumbing according to what fits best with your application. Trim to fit.



Installation Instructions

SMALL BLOCK MOPAR SINGLE

ARP-K-DG-LA



- Replace all spark plugs with one or two heat ranges cooler.
- Fuel/ Ignition managment system must be tuned when installing Torqstorm Supercharger.
- Reconnect battery
- Double check all fittings, bolts, clamps. Make sure all wires and lines are properly secured with clamps or wire ties .
- Make sure fuel tank is filled with 91 octane or higher fuel.
- Start engine and allow to idle a few minutes then shut down.
- Recheck to be sure that no hoses, wires, ect are near the exhaust, headers, or supercharger components.
- Recheck tune before commencing test drive.
- After test drive examine all bolts, belts and check for leaks or running issues before finishing with the vehicle.
- Oil must be changed every 10k miles or once a year, whichever comes first.
- Order oil direct from TorqStorm. Part number ARP-OIL-MTL
- Your TorqStorm Supercharger will have a 1 year limited warranty from the date on your paid invoice.


Additional information for Boost

- *It is suggested to run a wideband o2 sensor to monitor correct air/fuel ratio. 11.5 is ideal for 91 octane or higher pump gas.*
- *PLEASE TAKE SPECIAL NOTE: Operating the vehicle without all the sub assemblies completed and properly installed and working may cause FAILURE OF MAJOR ENGINE COMPONENTS.*
- *If you have any questions or concerns contact us at sales@torqstorm.com*
- *Torqstorm superchargers come from the factory filled with 6 oz of ARP-OIL-MTL*
- *Supercharger is ready to run*


BELT ROUTING

3.100" & 3.250" DIA PULLEYS USE
GATES BELT - K080530
DAYCO BELT = 5080530

3.500" DIA PULLEY USES
GATES BELT - K080537
DAYCO BELT = 5080537

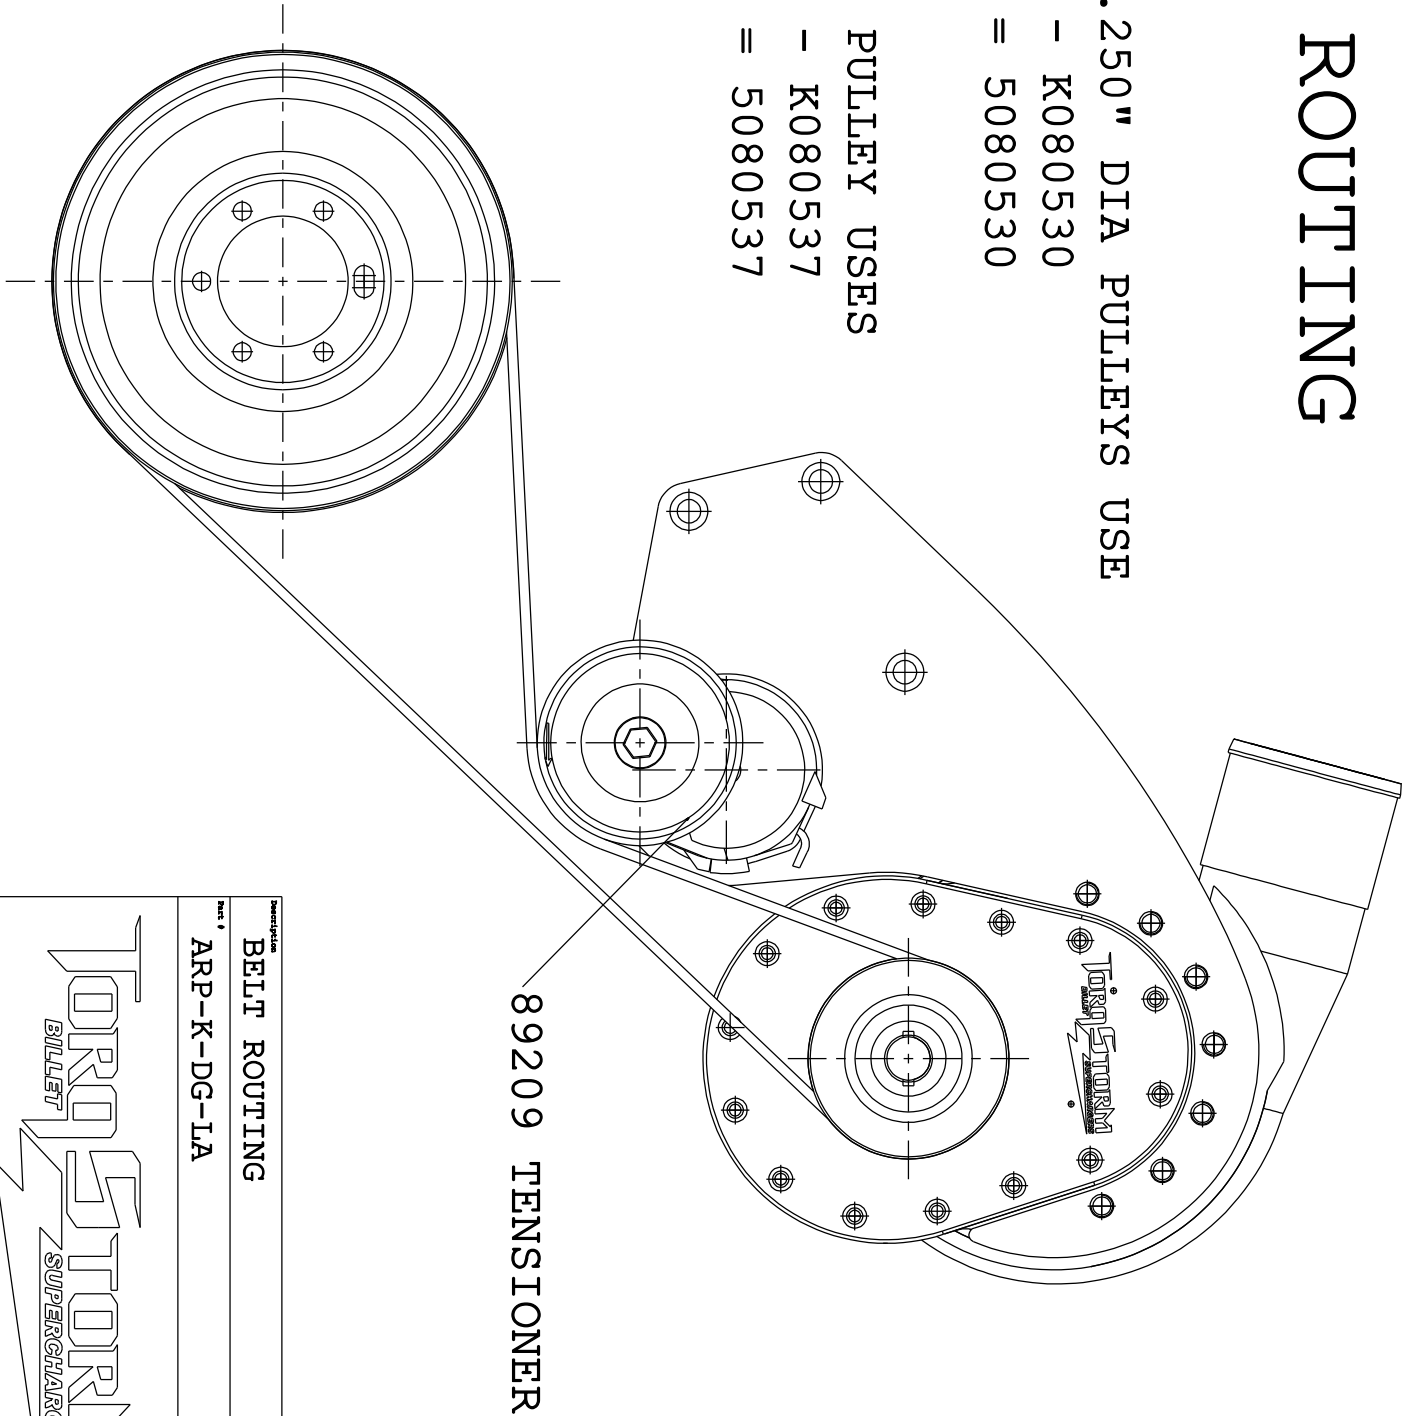

Description	
BELT ROUTING	
Part #	
ARP-K-DG-LA	

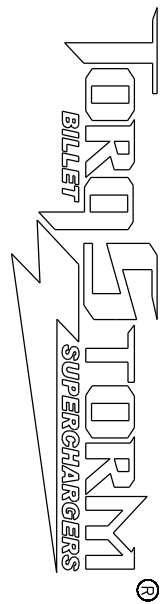



BOLT & SPACER LAYOUT

BOLTS

- A = 1 @ 3/8-16 x 4-1/2 SS SHCS
- B = 1 @ 3/8-16 x 5-1/2 SS SHCS
- C = 1 @ 3/8-16 x 5-1/2 SS SHCS
- D = 6 @ 5/16-18 x 1.0 SS SHCS
- E = 7 @ 3/8-16 x 1-1/4 SS SHCS


SPACERS


- A = 1 @ ARP-S-75-3750
- B = 1 @ ARP-S-75-0312
- C = 1 @ ARP-S-75-0312

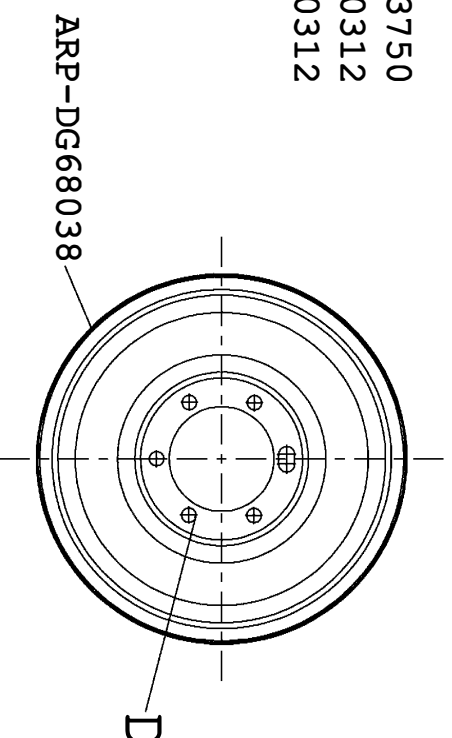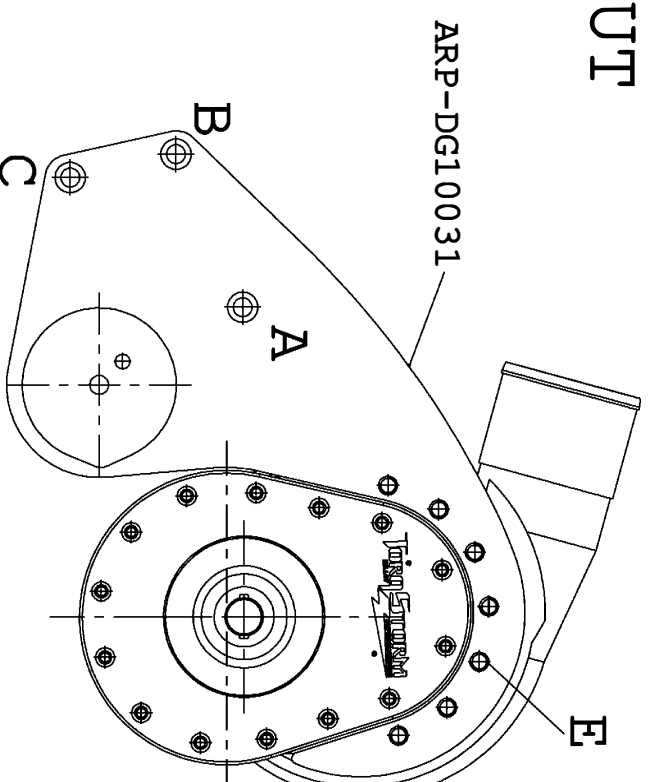

FOR NON POWER STEERING APPLICATIONS
REPLACE SPACER "C" WITH SUPPLIED ARP-S-75-0400

Part 1
BOLT & SPACER LAYOUT
ARP-K-DG-1A

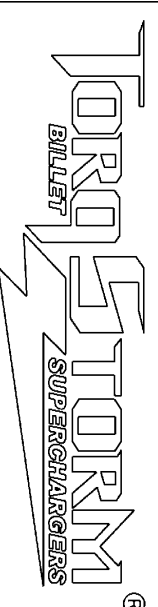

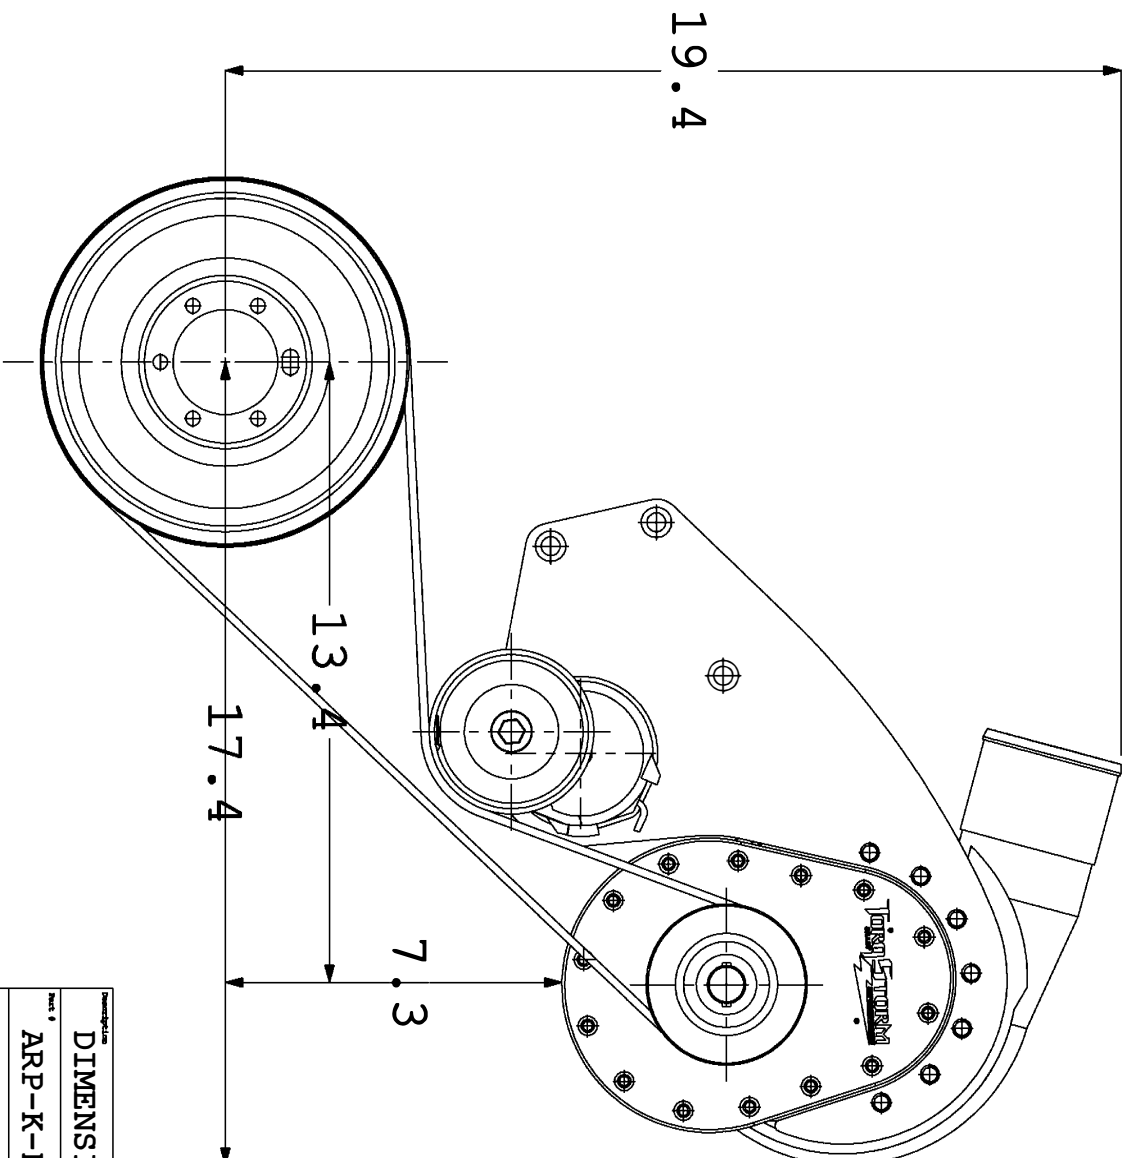

DESCRIPTION
DIMENSIONS

Part 9
ARP-K-DG-LA

TORO STORM
BILLET
SUPERCHARGERS

**OIL CHANGE MUST BE
PERFORMED EVERY 10,000
MILES OR ONCE A YEAR,
WHICHEVER COMES FIRST.**

**FAILURE TO DO SO WILL VOID
YOUR WARRANTY.**

**YOU CAN PURCHASE OIL
FROM US DIRECTLY AT
TORQSTORM.COM**

PART # ARP-OIL-MTL

STEP 1

Remove your supercharger from your car
and flip over to backside to access the drain
plug.

STEP 2

Remove drain plug with a 1/4" allen and drain oil.



STEP 3

*Pour in your Torqstorm specific oil,
6oz into the same hole you drained
from.*



STEP 4

*Replace the drain plug.
Torque to 15 ft lbs*



STEP 5

*Re-install the supercharger on your vehicle.
Take note of the mileage on your odometer.*

In many cases your vehicle is exposed to harsh weather and road debris. Regular maintenance is important in order for your mechanical pieces to function properly. BOV inspection every oil change interval.

STEP 1

You can leave the body of the BOV attached to your plumbing as long as your able to remove the lid from your BOV. Remove the lid, counter clockwise, there is a strong spring beneath it.



STEP 2

Remove the spring and brass piston. Clean and inspect the piston and spring for any abnormal wear or defects.



STEP 3

Using Silicone paste apply a modest amount inside the body of the BOV.

STEP 4

Install the brass piston into the body of the BOV, checking to make sure it goes in and out smoothly.

STEP 5

Install the spring into the piston, making sure it is seated flat in the “Cup”



STEP 6

Install the BOV cap. Make sure the spring is seated properly. Be careful not to cross thread it. A little wd-40 on the threads will help it to assemble easier.



STEP 7

Attach your vacuum line and check operation.



Accelerated Racing Products, LLC

Billet Supercharger Limited 1-Year Warranty

Accelerated Racing Products, LLC ("we," "our" or "us") warrants only to the original consumer purchaser ("you" or "your") that your new Billet Supercharger head unit (referred to herein as your "supercharger") shall be free of defects in workmanship and materials for 1 year, from the date of purchase. This Limited 1-Year Warranty (this "Limited Warranty") does not extend to any subsequent owner or other transferee of your supercharger and shall terminate upon any transfer of your supercharger. This Limited Warranty is effective for superchargers purchased on or after 1/01/2023.

Our authorization must be obtained before you return the supercharger for warranty inspection. Superchargers that we authorize to be inspected must be shipped freight prepaid, at your expense. Additional warranty procedures are set forth below.

Subject to the other limitations set forth in this Limited Warranty, we will, in our sole discretion, either repair or replace the supercharger or portion thereof subject to warranty free of charge. No refunds or credits will be allowed.

Superchargers will not qualify for warranty if (i) the supercharger pulley or impeller has been removed or changed, (ii) the pulley or impeller warranty seal has been broken or tampered with and/or (iii) the kit parts have been altered or improperly installed.

Further, this Limited Warranty does not cover any defects or damage due to: (i) transportation; (ii) storage; (iii) improper installation or use; (iii) failure to follow the product instructions; (iv) alterations or modifications without our prior written consent; (v) use of a component or accessory not approved by us; (vi) unauthorized repair; (vii) normal wear and tear; or (viii) external causes such as accidents, abuse, misuse or other actions or events beyond our reasonable control.

Superchargers that we repair or replace will be returned to you with ground transportation charges prepaid by us, within the continental United States, or to the point of embarkation within the continental United States, via UPS ground (or similar) service. You will be responsible for any charges associated with expedited delivery or freight charges outside the continental United States.

Superchargers authorized to be returned and inspected but which do not qualify for warranty, and which are not repaired at your expense, will be subject to a US\$100.00 inspection fee and returned to you, at your expense.

Warranty Procedure

Go to the website and fill out the Warranty/Repair form at: <https://torqstorm.com/warranty-repair-form/>

1. Serial number of the supercharger.
2. Description of the problem.
3. Make, Model, and Year of the vehicle.
4. Your name, shipping address (No PO Boxes allowed), and your daytime telephone number.
5. A copy of your original purchase invoice.
6. A clear picture of supercharger mounted in the vehicle.

Upon receipt of the above, if warranty service is appropriate, an Accelerated Racing Products Return Authorization Number will be assigned. You should then send the supercharger or other defective part, with all of the above information to:

Accelerated Racing Products LLC
2909 Buchanan Ave SW
Wyoming, MI 49548

The return authorization number must be included on the package. Freight collect shipments will be refused and returned to the sender at the sender's expense.

Disclaimers

THIS LIMITED WARRANTY GIVES YOU SPECIFIC LEGAL RIGHTS AND YOU MAY ALSO HAVE OTHER RIGHTS, WHICH VARY FROM STATE TO STATE.

WE HEREBY LIMIT THE DURATION AND REMEDIES OF ALL IMPLIED WARRANTIES, INCLUDING WITHOUT LIMITATION THE WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE, TO ONE YEAR.

SOME STATES DO NOT ALLOW LIMITATIONS ON HOW LONG AN IMPLIED WARRANTY LASTS, SO THE ABOVE LIMITATION MAY NOT APPLY TO YOU.

OUR RESPONSIBILITY FOR DEFECTIVE SUPERCHARGERS IS LIMITED TO REPAIR OR REPLACEMENT AS DESCRIBED ABOVE IN THIS LIMITED WARRANTY.

Limitation of Liability

THE REMEDIES DESCRIBED ABOVE ARE YOUR SOLE AND EXCLUSIVE REMEDIES AND OUR ENTIRE LIABILITY FOR ANY BREACH OF THIS LIMITED WARRANTY. OUR LIABILITY SHALL UNDER NO CIRCUMSTANCES EXCEED THE ACTUAL AMOUNT PAID BY YOU FOR THE DEFECTIVE SUPERCHARGER, NOR SHALL WE UNDER ANY CIRCUMSTANCES BE LIABLE FOR ANY CONSEQUENTIAL, INCIDENTAL, SPECIAL OR PUNITIVE DAMAGES OR LOSSES, WHETHER DIRECT OR INDIRECT (INCLUDING, WITHOUT LIMITATION, ENGINE DAMAGE).

SOME STATES DO NOT ALLOW THE EXCLUSION OR LIMITATION OF INCIDENTAL OR CONSEQUENTIAL DAMAGES, SO THE ABOVE LIMITATION OR EXCLUSION MAY NOT APPLY TO YOU.